HOME REPORT





ENERGY PERFORMANCE CERTIFICATE



Energy Performance Certificate (EPC)

Dwellings

Scotland

FLAT 2/3, 72 LANCEFIELD QUAY, GLASGOW, G3 8JF

Dwelling type: Mid-floor flat
Date of assessment: 16 June 2022
Date of certificate: 16 June 2022

Total floor area: 76 m²

Primary Energy Indicator: 148 kWh/m²/year

Reference number: 3212-4726-3000-0536-0296 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst


Main heating and fuel: Room heaters, electric

You can use this document to:

- . Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£1,626	See your recommendations
Over 3 years you could save*	£369	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

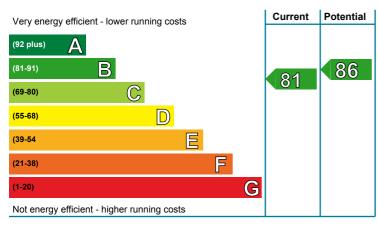


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band B (81)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

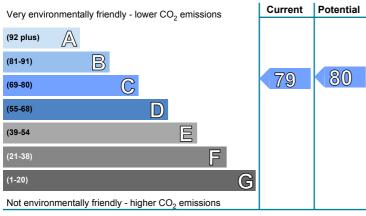

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (79)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Low energy lighting	£40	£138.00
2 High heat retention storage heaters	£1,200 - £1,800	£234.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	System built, as built, insulated (assumed)	****	★★★★☆
Roof	(another dwelling above)	_	_
Floor	(another dwelling below)	_	_
Windows	Fully double glazed	★★★★☆	★★★★ ☆
Main heating	Room heaters, electric	****	***
Main heating controls	Appliance thermostats	****	★★★★ ☆
Secondary heating	None	_	_
Hot water	Electric immersion, off-peak	***	***
Lighting	No low energy lighting	★ ☆☆☆	***

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 25 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 1.9 tonnes of carbon dioxide every year. You could reduce emissions by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£504 over 3 years	£378 over 3 years	
Hot water	£708 over 3 years	£642 over 3 years	You could
Lighting	£414 over 3 years	£237 over 3 years	save £369
Total	s £1,626	£1,257	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.


Da	samman dad maaayyaa	Indicative cost	Typical saving	Rating after improvement	
Re	commended measures	Indicative cost	per year	Energy	Environment
1	Low energy lighting for all fixed outlets	£40	£46	B 83	C 80
2	High heat retention storage heaters	£1,200 - £1,800	£78	B 86	C 80

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump

Choosing the right improvement package

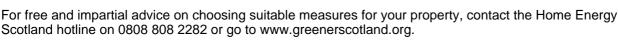



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting).

2 High heat retention storage heaters

Modern storage heaters are less expensive to run than the direct acting, on-peak heating system in the property. A dual-rate electricity supply is required to provide the off-peak electricity that these heaters use; this is easily obtained by contacting the energy supplier. Ask for a quotation for high heat retention with automatic charge and output controls. Installations should be in accordance with the national wiring standards. Building regulations generally apply to this work and a building warrant may be required, so it is best to obtain advice from your local authority building standards department and from a qualified electrical heating engineer. Ask the heating engineer to explain the options, which might also include switching to other forms of electric heating.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	1,047	N/A	N/A	N/A
Water heating (kWh per year)	1,883			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Scott Baird Assessor membership number: EES/009369

Company name/trading name: D M Hall Chartered Surveyors LLP

Address: 45 Bank Street

Irvine KA12 0LL

Phone number: 0131 477 6000
Email address: dmhall@dmhall.co.uk
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



SINGLE SURVEY



survey report on:

FLAT 2/3, 72 LANCEFIELD QUAY, GLASGOW, G3 8JF
Mr Vibh Mehta
DM Hall LLP
16th June 2022



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
 or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a purpose built flat occupying a second floor position, set within a thirteen storey block of similar units with one retail/commercial unit occupying a ground floor position within the building. There are residents secure parking facilities occupying ground and first floor positions within the building. The retail/commercial unit at ground floor comprises of a Convenience Store.
Accommodation	ON SECOND FLOOR: Entrance hall, lounge open plan to kitchen, master bedroom with en-suite shower room, one further bedroom, bathroom.
Gross internal floor area (m²)	71m² or thereby.
Neighbourhood and location	The subjects form part of the River Heights residential development situated within an area of mixed residential and commercial use to the west of Glasgow City Centre. The property is conveniently positioned for local shopping, education and transport facilities.
	The River Clyde is situated in close proximity.
Age	17 years approximately.
Weather	Dull and overcast at the time of inspection. Weather conditions over recent weeks have been mixed.
Chimney stacks	There are no chimney stacks.

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
	ROOF:
	The main roof to the building would appear to be of a flat design, where visible overlaid with a sarnafil roof membrane and metal claddings. Sections of the roof to the building incorporate terracing.
	ROOF SPACE :
	Given the roof design there is no roof void in the building to inspect.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	Rainwater units are predominantly concealed within the building fabric and are not visible for inspection. Some sections of downpipes were visible which are of a PVC design.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls are assumed to be of a modern steel framed construction having a cavity infill with an external finish comprising powerwall render, metal claddings, glass curtain walling, terracotta and marble effect tiles.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	Windows are of metal/aluminium framed double glazed type.
	The entrance door is timber.
External decorations	Visually in proceed
External decorations	Visually inspected.
	Exterior finishes are painted where appropriate.
Conservatories / porches	None.

	T
Communal areas	Circulation areas visually inspected.
	There is a shared entrance hallway and stair and lift access within the building.
Garages and permanent outbuildings	Visually inspected.
	Situated within the building there are residents secure parking facilities and a communal bin store area.
	I am advised that there is an allocated parking space pertaining to the property. This can be confirmed by reference to the Title Deeds.
Outside areas and boundaries	Visually inspected.
	The building is set directly off the main public footpath. No communal garden grounds were noted.
Ceilings	Visually inspected from floor level.
	Ceilings appear of a plasterboard design with a decorated finish.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Internal walls are of timber and plaster construction with a decorated finish.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	Flooring would appear to be of a solid design overlaid with a range of fitted floor finishes.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	There are timber skirtings and door facings and internal doors are timber.
	The kitchen contains a range of floor and wall mounted storage units and worktops.

Chimney breasts and fireplaces	None.
lutamal da contiana	
Internal decorations	Visually inspected.
	Decorative finishes are generally painted.
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains supply. The electrical switchgear is located within a hall cupboard.
	Visible cabling is of PVC material and power is supplied to 13 amp sockets.
Gas	There is no mains gas supply.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Mains water supply. Visible pipework is of copper and PVC materials.
	Sanitary fittings in the bathroom comprise white suite of W.C., wash hand basin and bath.
	The shower room contains white suite of W.C., wash hand basin and shower cubicle.
	There is a sink unit in the kitchen.
Heating and hot water	Accessible parts of the system were visually inspected apart
	from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	Heating is provided by wall mounted electric panel radiators.
	Domestic hot water would appear to be from an electric immersion heater which is fitted to an insulated hot water storage tank located within the hall cupboard.

Drainage covers etc were not lifted. Neither drains nor drainage systems were tested. Drainage is assumed to be connected to the mains sewerage system.

Fire, smoke and burglar alarms

Visually inspected.

No tests whatsoever were carried out to the system or appliances.

There are smoke alarms fitted within the property.

Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.

Any additional limits to inspection

For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

The property was occupied, fully furnished and all floors were covered. Floor coverings restricted my inspection of flooring.

In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects (particularly in cupboards). Floor coverings have not been moved.

Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection.

My inspection of the roof covering was restricted from ground level and some parts were not visible. Site topography partially blocked

Any additional limits to inspection	sight lines. The flat roof coverings were not visible from ground level.
	I was unable to see below the bath and shower tray.

Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6 Ridge board
- 7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- (13) Roof felt
- (14) Trusses
- (15) Collar
- 16 Insulation
- (17) Parapet gutter
- 18) Eaves guttering
- 19) Rainwater downpipe
- 20) Verge boards/skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- (25) Window pointing
- 6) Window sills
- 27) Rendering
- 28) Brickwork / pointing
- 29) Bay window projection
- 30 Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33) Damp proof course
- 34) Base course
- 35) Foundations
- (36) Solum
- 37) Floor joists
- 38) Floorboards
- 39) Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	No obvious evidence of significant movement noted within the limitations of my inspection.

Dampness, rot and infestation	
Repair category	1
Notes	No obvious evidence of significant dampness, rot or wood boring insect infestation.

Chimney stacks	
Repair category	-
Notes	None.

Roofing including roof space	
Repair category	2
Notes	The flat roof of the building has a limited life expectancy and can fail without warning. A reputable roofing contractor will be able to provide further advice. Continual and on-going maintenance to flat roofs should be anticipated, along with eventual re-covering.

Rainwater fittings	
Repair category	1
Notes	No significant defects evident based on the limitations of the inspection.

Main walls	
Repair category	3
Notes	The Ministry for Housing, Communities and Local Government (MHCLG) have provided advice on multi storey properties where there are elements within the external wall system or attachments which may contain combustible material. We suggest the building owners, and/or their agents, produce a written report (EWS1 form), prepared by a suitably qualified independent professional advisor who is a member of one of the professional bodies approved by the MHCLG to confirm that the subject property meets the requirements of the current MHCLG advice. The valuation assumes that the EWS1 form will satisfy both the purchaser and the purchasers lender and that no significant expenditure will be incurred in terms of recommended remedial action. Please note that the surveyor does not warrant the EWS1 form and is not in a position to comment on the EWS1 form or its content. There is some weathering/staining to the render finish. Surface cracking was noted in places. Some cracked sections of wall tiling were noted. An appropriate Contractor can advise on any necessary repair.

Windows, external doors and joinery	
Repair category	1
Notes	No significant defects evident.

External decorations	
Repair category	1
Notes	No significant defects evident.

Conservatories/porches	
Repair category	-
Notes	None.

Communal areas	
Repair category	1
Notes	No significant defects evident.

Garages and permanent outbuildings	
Repair category	1
Notes	No significant defects evident.

Outside areas and boundaries	
Repair category	-
Notes	None.

Ceilings	
Repair category	1
Notes	Plaster damage was noted to the ceiling within the bathroom.

Internal walls	
Repair category	2
Notes	Plaster damage and staining was noted to wall surfaces within the bathroom. This area was dry when inspected.

Floors including sub-floors	
Repair category	1
Notes	No significant defects evident. It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.

Internal joinery and kitchen fittings	
Repair category	1
Notes	The kitchen units have been affected by general wear and tear.

Chimney breasts and fireplaces	
Repair category	-
Notes	None.

Internal decorations	
Repair category	1
Notes	No significant defects although general wear and tear was evident.

Cellars	
Repair category	-
Notes	None.

Electricity	
Repair category	1
Notes	It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IEE regulations.

Gas	
Repair category	-
Notes	None.

► Water, plumbing and bathroom fittings	
Repair category	2
Notes	Seals around the bath/shower areas are worn. Failure to seals can result in dampness/decay within hidden areas of the property.

Heating and hot water	
Repair category	1
Notes	No significant defects evident. It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant Regulations.

Drainage	
Repair category	1
Notes	No significant defects evident.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	2
Rainwater fittings	1
Main walls	3
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	1
Garages and permanent outbuildings	1
Outside areas and boundaries	-
Ceilings	1
Internal walls	2
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	1
Gas	-
Water, plumbing and bathroom fittings	2
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Second
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes X No
4. Are all door openings greater than 750mm?	Yes X No
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

Ideally building owners should obtain design records, construction details, specifications and system certification for the External Wall system, and appoint suitable professional advisers to assess the adequacy of the design and installation.

The Building factor should be asked to confirm that there are no planned or outstanding repair schemes for the building containing the flat. The flat may have a common building reinstatement policy.

The subjects form part of a block of flats and it has been assumed that maintenance/repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed.

It is understood there are factoring arrangements in place in respect of the maintenance and upkeep of communal areas. This should be verified by the completing conveyancer.

The subjects are situated in close proximity to a river. I am unaware of any recent flooding at this location, however the location should be brought to the attention of the buildings insurers. I have assumed that buildings insurance will be available on normal terms.

I am advised that there is an allocated parking space pertaining to the property. This can be verified by inspection of the Title Deeds.

Estimated	l reinstatemen	t cost for i	insurance	purposes

£175,000 (One Hundred and Seventy Five Thousand Pounds).

Valuation and market comments

£180,000 (One Hundred and Eighty Thousand Pounds).

The opinion of Market Value is provided on the basis that the comments under walls and/or valuation and conveyancer issues have been satisfied. Where remedial works are recommended to the building we reserve the right to reconsider the Market Value.

Signed	Security Print Code [462177 = 5138] Electronically signed

Report author	Christopher Pidgeon

Company name	DM Hall LLP
Address	151/153 Kilmarnock Road, Shawlands, Glasgow, G41 3JF
Date of report	29th June 2022

Mortgage Valuation Report



Property Address	
Address Seller's Name Date of Inspection	FLAT 2/3, 72 LANCEFIELD QUAY, GLASGOW, G3 8JF Mr Vibh Mehta 16th June 2022
Property Details	
Property Type	House Bungalow Purpose built maisonette Converted maisonette X Purpose built flat Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)
Property Style	□ Detached □ Semi detached □ Mid terrace □ End terrace □ Back to back ▼ High rise block □ Low rise block □ Other (specify in General Remarks)
Does the surveyor be e.g. local authority, m	elieve that the property was built for the public sector, Yes X No nilitary, police?
Flats/Maisonettes on	ly Floor(s) on which located Second No. of floors in block 13 Lift provided? X Yes No No. of units in block 103
Approximate Year of	Construction 2005
Tenure	
X Absolute Ownership	Leasehold Ground rent £ Unexpired years
Accommodation	
Number of Rooms	1 Living room(s) 2 Bedroom(s) 1 Kitchen(s) 2 Bathroom(s) 0 WC(s) 0 Other (Specify in General remarks)
Gross Floor Area (ex	cluding garages and outbuildings) 71 m² (Internal) 84 m² (External)
Residential Element ((greater than 40%) X Yes No
Garage / Parking /	Outbuildings
Single garage Available on site?	□ Double garage ▼ Parking space □ No garage / garage space / parking space ▼ Yes □ No
Permanent outbuildin	ngs:
None noted.	

Construction								
Walls	Brick	Stone	Concre	te Timber	frame	X Other	(specify in Gen	eral Remarks)
Roof	Tile	Slate	Asphal	t Felt		X Other	(specify in Gen	eral Remarks)
Special Risks								
Has the property s	suffered stru	ctural movem	ent?				Yes	X No
If Yes, is this rece	nt or progres	sive?					Yes	☐ No
Is there evidence, immediate vicinity	history, or re?	eason to antic	ipate subsider	nce, heave, lan	dslip or flo	od in the	Yes	X No
If Yes to any of the	e above, pro	vide details in	General Rem	arks.				
Service Connec	etion							
		If any comi		ha nan maina	mlanan an			ad lo option
Based on visual ir of the supply in G	eneral Rema	y. If any servi rks.	ces appear to	be non-mains,	piease co	mment o	n the type ar	id location
Drainage	X Mains	Private	None	W	ater X	Mains	Private	None
Electricity	X Mains	Private	None	Ga	as 🗌	Mains	Private	X None
Central Heating	Yes	X Partial	None					
Brief description of	of Central He	ating:						
Electric panel ra	diators.							
Site								
Apparent legal iss	ues to be ve	rified by the c	onveyancer. F	Please provide a	a brief des	cription i	n General Re	emarks.
Rights of way	X Shared dr	ves / access	Garage or of	her amenities on s	eparate site	Share	ed service conn	ections
III-defined boundar	ies	Agricu	ltural land include	d with property		Othe	r (specify in Ger	neral Remarks)
Location								
Residential suburb	Re	esidential within t	own / city X I	Mixed residential /	commercial	Main	ly commercial	
Commuter village	Re	emote village		solated rural prope	erty	Othe	r (specify in Ger	neral Remarks)
Planning Issues	5							
Has the property b	oeen extende	ed / converted	I / altered?	Yes X No				
If Yes provide deta	ails in Gener	al Remarks.						
Roads								
X Made up road	Unmade ro	ad Partly	completed new r	oad Pede	strian access	s only	Adopted	Unadopted

General Remarks

Generally the subjects were found to be in a condition commensurate with age and style of construction. There is wear and tear to some items requiring routine maintenance repair or upgrading.

The Building factor should be asked to confirm that there are no planned or outstanding repair schemes for the building containing the flat. The flat may have a common building reinstatement policy.

The subjects form part of a block of flats and it has been assumed that maintenance/repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed.

It is understood there are factoring arrangements in place in respect of the maintenance and upkeep of communal areas. This should be verified by the completing conveyancer.

The Ministry for Housing, Communities and Local Government (MHCLG) have provided advice on multi storey properties where there are elements within the external wall system or attachments which may contain combustible material. We suggest the building owners, and/or their agents, produce a written report (EWS1 form), prepared by a suitably qualified independent professional advisor who is a member of one of the professional bodies approved by the MHCLG to confirm that the subject property meets the requirements of the current MHCLG advice. The valuation assumes that the EWS1 form will satisfy both the purchaser and the purchasers lender and that no significant expenditure will be incurred in terms of recommended remedial action. Please note that the surveyor does not warrant the EWS1 form and is not in a position to comment on the EWS1 form or its content.

Ideally building owners should obtain design records, construction details, specifications and system certification for the External Wall system, and appoint suitable professional advisers to assess the adequacy of the design and installation

The opinion of Market Value is provided on the basis that the comments under walls and/or valuation and conveyancer issues have been satisfied. Where remedial works are recommended to the building we reserve the right to reconsider the Market Value.

The subjects are situated in close proximity to a river. I am unaware of any recent flooding at this location, however the location should be brought to the attention of the buildings insurers. I have assumed that buildings insurance will be available on normal terms.

I am advised that there is an allocated parking space pertaining to the property. This can be verified by inspection of the Title Deeds.

The main walls are assumed to be of a modern steel framed construction having a cavity infill with external finish comprising powerwall render, metal claddings, glass curtain walling, terracotta and marble effect tiles.

The main roof to the building would appear to be of a flat design, where visible overlaid with a sarnafil roof membrane and metal claddings. Sections of the roof to the building incorporate terracing.

Essential Repairs	
None apparent.	
Estimated cost of essential repairs £ Retention recommended? Yes X No Amo	ount £
Comment on Mortgageability	
The property will form suitable mortgage security for mortgage purposes depending on the Purchas Lender and their lending criteria. Further reports may be requested by a Lender to satisfy themselve safety requirements. Accordingly, subsequent reporting to a Lender may differ from the Home Reports Should this be required, our valuation assumes that satisfactory fire safety reports will be acceptable Purchaser and the Purchasers Lender.	es on fire ort content.
Valuations	
Market value in present condition Market value on completion of essential repairs Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT) Is a reinspection necessary?	£ 180,000 £ £ 175,000
Buy To Let Cases	
What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis?	£
Is the property in an area where there is a steady demand for rented accommodation of this type?	Yes No

Declaration

Signed Security Print Code [462177 = 5138]

Electronically signed by:-

Surveyor's name Christopher Pidgeon
Professional qualifications BSc (Hons) MRICS

Company name DM Hall LLP

Address 151/153 Kilmarnock Road, Shawlands, Glasgow, G41 3JF

 Telephone
 0141 636 4141

 Fax
 0141 632 5473

 Report date
 29th June 2022

PROPERTY QUESTIONNAIRE





Property address FLAT 2/3 , 72 LANCEFIELD QUAY GLASGOW, G3 8JF	
Seller(s)	MR VIBHAKAR MEHTA MRS HARSHA MEHTA
	,
Completion date of property questionnaire	4 july 2022

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership
	How long have you owned the property? SINCE 2005
2.	Council tax
	Which Council Tax band is your property in? (Please tick one)
3.	Parking
	What are the arrangements for parking at your property? (Please tick all that apply)
	• Garage
	• Allocated parking space $\square X$
	• Driveway
	Shared parking
	• On street
	Resident permit
	Metered parking
	Other (please specify):
4.	Conservation area
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?

5.	Listed buildings			
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	☐ Yes ☐ No X		
6.	Alterations/additions/extensions			
а.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	☐ Yes ☐ No x		
	If you have answered yes, please describe below the changes which you have made:			
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	☐ Yes		
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	N/A		
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:			
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	☐ Yes ☐ No X		
	If you have answered yes, please answer the three questions below:	□ NO X		
	(i) Were the replacements the same shape and type as the ones you replaced?	☐ Yes ☐ No		
	(ii) Did this work involve any changes to the window or door openings?	☐ Yes ☐ No		
	(iii) Please describe the changes made to the windows doors, or patio approximate dates when the work was completed):	doors (with		
	Please give any guarantees which you received for this work to your so agent.			

7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). If you have answered yes or partial — what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). If you have answered yes, please answer the three questions below:	☐ Yes X ☐ No ☐ Partial
	(i) When was your central heating system or partial central heating 2005	g system installed?
	(ii) Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance contract:	☐ Yes ☐ No X
	(iii) When was your maintenance agreement last renewed? (Please and year).	provide the month
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	☐ Yes X ☐ No
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	☐ Yes ☐ No X
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	☐ Yes ☐ No
b.	Are you aware of the existence of asbestos in your property? If you have answered yes, please give details:	☐ Yes ☐ No DON'T KNOW

10.	Services					
a. Please tick which services are connected to your property and give details of the supplier:						
		Services	Connected	Supplier		
	Gas or liquid petroleum gas		NO	NO	NO	
		Water mains or private water supply	YES	DON'T KNOW		
		Electricity	YES DON'T KNOW		w	
	Mains drainage YES DON'T KN		DON'T KNO	ow		
Telephone		Telephone	YES	DON'T KNOW		
	Cable TV or satellite		YES	DON'T KNOW		
		Broadband	YES	DON'T KNO	w	
b.	Is	there a septic tank sys	tem at your property?		☐ Yes	
	If you have answered yes, please answer the two questions below: □ No □ DON'T KNOW					KNOW
C.	Do you have appropriate consents for the discharge from your septic					t Know X
d.	If you have answered yes, please give details of the company with				☐ Yes ☐ No DON'T KNOW	

11.	Responsibilities for shared or common areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	☐ Yes X ☐ No ☐ Don't Know
	If you have answered yes, please give details:	Don't Know
	THRU MANAGEMENT COMPANY	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?	☐ Yes X ☐ No
	If you have answered yes, please give details:	☐ Not applicable
	THRU MANAGEMENT COMPANY	
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	☐ Yes ☐ No X
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?	☐ Yes ☐ No DON'T KNOW
	If you have answered yes, please give details:	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	☐ Yes ☐ No
	If you have answered yes, please give details:	DON'T KNOW
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privatelyowned.)	☐ Yes ☐ No X
	If you have answered yes, please give details:	
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property?	☐ Yes X
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	□ No
	NEWTON PROPERTY MANAGEMENT LTD	
	87 PORT DUNDAS ROAD, GLASGOW. G4 0HF	
	TEL 0141 353 9700	

b.	Is there a common buildings insurance policy? If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	☐ Yes ☐ No ☐ Don't Know X ☐ Yes ☐ No ☐ Don't Know
C.	Please give details of any other charges you have to pay on a regular bupkeep of common areas or repair works, for example to a residents' amaintenance or stair fund.	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	☐ Yes ☐ No DON'T KNOW
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? If you have answered yes, please give details:	☐ Yes ☐ No DON'T KNOW
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	☐ Yes ☐ No

14.	Guarantees					
a.	Are there any guarantees or warranties for any of the following:					
		No	Yes	Don't know	With title deeds	Lost
(i)	Electrical work			□х		
(ii)	Roofing			□х		
(iii)	Central heating			□х		
(iv)	National House Building Council (NHBC)			□х		
(v)	Damp course			□х		
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)			□х		
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):					
c.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:				☐ Yes ☐ No DON'T KNO	W
15.	Boundaries					
	So far as you are aware, has any boundary moved in the last 10 years? If you have answered yes, please give deta		oroperty	been	☐ Yes ☐ No ☐ Don't kn	ow X

16.	Notices that affect your property		
	In the past three years have you ever received a notice:		
a.	advising that the owner of a neighbouring property has made a planning application?	☐ Yes ☐ No X	
b.	that affects your property in some other way?	☐ Yes ☐ No X	
c.	that requires you to do any maintenance, repairs or improvements to your property?	☐ Yes ☐ No X	
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.		

DM Hall Offices

Aberdeen 01224 594172 Galashiels 01896 752009 Livingston 01506 490404

Ayr

01292 286974

Glasgow (North) 0141 332 8615

Musselburgh 0131 665 6782

Cumbernauld

01236 618900

Glasgow (South)

0141 636 4141

01631 564225

Cupar

01334 844826

Hamilton

01698 284939

Paisley

Oban

0141 887 7700

Dumfries

01387 254318

Inverness

01463 241077

Perth

01738 562100

Dundee

01382 873100

Inverurie

01467 624393

Peterhead

01779 470220

Dunfermline

01383 621262

Irvine

01294 311070

Stirling

01786 475785

Edinburgh

0131 477 6000

Kirkcaldy

01592 598200

Elgin

01343 548501

DMHALL.CO.UK









01324 628321